

IEC 61508 Functional Safety Assessment

Project:
Micro Motion 1700/2700 Coriolis Flowmeter
with Standard or Enhanced Core

Company: Emerson Boulder, Colorado USA

Contract No.: Q23/01-183
Report No.: EMM 08/04-67 R005
Version V4, Revision R1, June 2, 2023
Valerie Motto



Management Summary

This report summarizes the results of the Functional Safety Assessment according to IEC 61508 carried out on the:

- Micro Motion 1700/2700 Coriolis Flowmeter with Standard 700 Core Processor
- Micro Motion 1700/2700 Coriolis Flowmeter with Enhanced 800 Core Processor

The Functional Safety Assessment performed by *exida* consisted of the following activities:

- exida assessed the development process used by Emerson through an audit and review of a detailed safety case against the exida certification scheme which includes the relevant requirements of IEC 61508. The assessment was executed using subsets of the IEC 61508 requirements tailored to the work scope of the development team.
- exida reviewed and assessed a detailed Failure Modes, Effects, and Diagnostic Analysis (FMEDA) of the devices to document the hardware architecture and failure behavior.
- exida reviewed field failure data to verify the accuracy of the FMEDA analysis.

exida reviewed the manufacturing quality system in use at Emerson

The functional safety assessment was performed to the SIL 3 requirements of IEC 61508:2010. A full IEC 61508 Safety Case was prepared, using the exida SafetyCase tool, and used as the primary audit tool. The Enhanced Core Processor is an upgrade to the previously certified 1700 and 2700 Coriolis Flow and Density Transmitters with the 700 Core Processor. This assessment took into consideration the previous assessment, changes and additions to the product, enhancements to the development process, and the process requirements to implement these changes.

The results of the Functional Safety Assessment can be summarized by the following statements:

The audited development process, as tailored and implemented by the Micro Motion 1700/2700 Coriolis Flowmeter development project, complies with the relevant safety management requirements of IEC 61508 SIL 3.

The assessment of the FMEDA, done to the requirements of IEC 61508, has shown that the Micro Motion 1700/2700 Coriolis Flowmeter can be used in a low demand safety related system in a manner where the PFD_{AVG} is within the allowed range for SIL 2 according to table 2 of IEC 61508-1.

The assessment of the FMEDA also shows that the Micro Motion 1700/2700 Coriolis Flowmeter meets the requirements for architectural constraints of an element such that it can be used to implement a SIL 2 safety function (with HFT = 0) or a SIL 3 safety function (with HFT = 1).

This means that the Micro Motion 1700/2700 Coriolis Flowmeter is capable for use in SIL 3 applications in Low demand mode when properly designed into a Safety Instrumented Function per the requirements in the Safety Manual and when using the versions specified in section 3.1 of this document.

This means that the Micro Motion 1700/2700 Coriolis Flowmeter with either the 700 or 800 Core are capable for use in SIL 3 applications in Low or High demand mode when properly designed into a Safety Instrumented Function per the requirements in the Safety Manual and when using the versions specified in section 3.1 of this document.



The manufacturer will be entitled to use the Functional Safety Logo.







Table of Contents

Ma	nage	ement Summary	2
1	Pur	pose and Scope	6
2	Proj	ject Management	7
	2.1	exida	7
	2.2	Roles of the parties involved	7
	2.3	Standards / Literature used	7
	2.4	Reference documents	7
		2.4.1 Documentation provided by Emerson	7
		2.4.2 Documentation generated by exida	10
3	Pro	duct Description	12
	3.1	Hardware and Software Version Numbers	14
4	IEC	61508 Functional Safety Assessment Scheme	15
	4.1	Methodology	15
	4.2	Assessment level	16
5	Res	sults of the IEC 61508 Functional Safety Assessment	17
		Lifecycle Activities and Fault Avoidance Measures	
		5.1.1 Functional Safety Management	
		5.1.2 Safety Requirements Specification and Architecture Design	18
		5.1.3 Hardware Design	18
		5.1.4 Software Design	18
		5.1.5 Validation	19
		5.1.6 Verification	19
		5.1.7 Modifications	19
		5.1.8 User documentation	
		Proven in Use	
	5.3	Hardware Assessment	20
6	202	3 IEC 61508 Functional Safety Surveillance Audit	21
	6.1	Roles of the parties involved	21
	6.2	Surveillance Methodology	21
		6.2.1 Documentation provided by Emerson	22
		6.2.2 Surveillance Documentation generated by exida	25
	6.3	Surveillance Results	25
		6.3.1 Procedure Changes	25
		6.3.2 Engineering Changes	
		6.3.3 Impact Analysis	
		6.3.4 Field History	
		6.3.5 Safety Manual	26



	6.3.6 FMEDA Update	26
	6.3.7 Evaluate use of certificate and/or certification mark	26
	6.3.8 Previous Recommendations	26
	6.3.9 Additional Manufacturing locations	26
	6.3.10 Assessed Configurations / Versions	27
	6.4 Surveillance Audit Conclusion	27
7	Terms and Definitions	28
8	Status of the document	29
	8.1 Liability	29
	8.2 Version History	29
	8.3 Future Enhancements	29
	8.4 Release Signatures	29



1 Purpose and Scope

This document shall describe the results of the IEC 61508 functional safety assessment of the:

- Micro Motion 1700/2700 Coriolis Flowmeter with Standard 700 Core Processor
- Micro Motion 1700/2700 Coriolis Flowmeter with Enhanced 800 Core Processor

by exida according to the accredited exida certification scheme which includes the requirements of IEC 61508: 2010.

The purpose of the assessment was to evaluate the compliance of:

- the Micro Motion 1700/2700 Coriolis Flowmeter with the technical IEC 61508-2 and -3 requirements for SIL 3 and the derived product safety property requirements

and

- the Micro Motion 1700/2700 Coriolis Flowmeter development processes, procedures and techniques as implemented for the safety-related deliveries with the managerial IEC 61508-1. -2 and -3 requirements for SIL 3.

and

- the Micro Motion 1700/2700 Coriolis Flowmeter hardware analysis represented by the Failure Mode, Effects and Diagnostic Analysis with the relevant requirements of IEC 61508-2.

The assessment has been carried out based on the quality procedures and scope definitions of exida.

The results of this assessment provide the safety instrumentation engineer with the required failure data per IEC 61508 / IEC 61511 and confidence that sufficient attention has been given to systematic failures during the development process of the device.

1.1 Tools and Methods used for the assessment

This assessment was carried out by using the exida Safety Case tool. The Safety Case tool contains the exida scheme which includes all the relevant requirements of IEC 61508.

For the fulfillment of the objectives, expectations are defined which builds the acceptance level for the assessment. The expectations are reviewed to verify that each single requirement is covered. Because of this methodology, comparable assessments in multiple projects with different assessors are achieved. The arguments for the positive judgment of the assessor are documented within this tool and summarized within this report.

The assessment was planned by *exida* and agreed to with Emerson.

All assessment steps were continuously documented by exida (see [R1] to [R9]).



2 Project Management

2.1 exida

exida is one of the world's leading accredited Certification Bodies and knowledge companies, specializing in automation system safety and availability with over 500 years of cumulative experience in functional safety. Founded by several of the world's top reliability and safety experts from assessment organizations and manufacturers, exida is a global company with offices around the world. exida offers training, coaching, project-oriented system consulting services, safety lifecycle engineering tools, detailed product assurance, cyber-security and functional safety certification, and a collection of on-line safety and reliability resources. exida maintains a comprehensive failure rate and failure mode database on process equipment based on 350 billion hours of field failure data.

2.2 Roles of the parties involved

Emerson Manufacturer of the Coriolis Flowmeter with 1700 / 2700 Transmitter

exida Performed the hardware assessments [R1] and [R2]

exida Performed the IEC 61508 Functional Safety Assessment

Emerson contracted *exida* in September 2008 with the IEC 61508 Functional Safety Assessment and certification renewal of the above-mentioned devices.

2.3 Standards / Literature used

The services delivered by exida were performed based on the following standards / literature.

[N1]	IEC 61508 (Parts 1 - 7):	Functional Safety of Electrical/Electronic/Programmable
	2010, 2 nd ed.	Electronic Safety-Related Systems

2.4 Reference documents

Note: Documents revised after the 2008 audit are updated in Section 6, 2023 IEC 61508 Functional Safety Surveillance Audit.

2.4.1 Documentation provided by Emerson

[D1]	Flow Measurement Quality Manual.pdf, Rev. AH	1700/2700 Transmitter SafetyCaseDB
[D2]	GWI 140 New Product Development Process.docx; Rev. C	GWI 140 New Product Development Process
[D3]	ER-20012896, Rev 0.4, 7/8/08	2400S Series Project Development Plan
[D4]	801CRD.DOC, Rev 1.1	Model 800 Enhanced Core Processor Customer Requirements Document
[D5]	MMI SIL 2700 SASRD.doc, Rev 0.5	1700 / 2700 Coriolis Flowmeter System Architecture and Safety Requirements Specification



[D6]	LWI 133, Rev M	Local Work Instruction 133 - System, Architecture and
,		Safety Requirements Guidelines
[D7]	LWI 23, Rev AJ	Local Work Instruction 127 - Requirements Management Procedure (incorporated within LWI23)
[D8]	LWI 23, Rev AJ	Local Work Instruction 132 - Software and Embedded System Project Planning (incorporated within LWI23)
[D9]	LWI 23, Rev AJ	Local Work Instruction 129 - Embedded Software Development Procedure (incorporated within LWI23)
[D10]	LWI 23, Rev AJ	Local Work Instruction 23 - Software Development Process
[D11]	LWI 23, Rev AJ	Local Work Instruction 188 - C and C++ Coding Guideline (incorporated within LWI23)
[D12]	LWI 23, Rev AJ	Local Work Instruction 126 - Software Quality Assurance Audits Procedure (incorporated within LWI23)
[D13]	LWI 23, Rev AJ	Completed Embedded Development Project Audit Checklist (per LWI 126) (incorporated within LWI23)
[D14]	LWI 23, Rev AJ	Local Work Instruction 24 - Product Development Configuration Management (incorporated within LWI23)
[D15]	LWI 23, Rev AJ	Local Work Instruction 130 - Product and Process Reviews (incorporated within LWI23)
[D16]	LWI 31, Rev P	Local Work Instruction 31 - Inspection and Test Equipment Calibration
[D17]	CP 36, Rev Q	Control Procedure 36 - ECR/ECO Procedure (Engineering Change Request)
[D18]	ER- 20004869, Rev A.14	800 Series SRS (Software Requirement Specification)
[D19]	80xSDD, Rev 0.4, 1/29/07	80x Series Software Design Description (SDD)
[D20]	80xSDD_Minutes_rev0_1.d oc	Software Design Document Review Minutes
[D21]	MVD SOFTWARE REVISION OVERVIEW.pdf; Rev. BZ	2400/ECP Enhanced Core Processor Software Release history
[D22]	Various	Sample ECR showing the SIL requirements
[D23]	GWI 358 Stop Ship Procedure .docx, Rev M	Control Procedure 58 - Stop / Resume Ship Procedure
[D24]	CP 58-F1	Stop Ship Authorization Form
[D25]	GWI 358 Stop Ship Procedure .docx, Rev M	Control Procedure 5 - Product Safety
[D26]	LWI 26	Local Work Instruction 26 - Checklist for Safety
[D27]	GWI 336-A5 SIL Impact Analysis Worksheet.docx, Rev. A	SIL Impact Analysis Worksheet (CP36 Attachment 9)



[D28]	ECP800 Version 342 TB Rev 1.doc	Technical Bulletin for ECP800 Ver 3.42 Software Release
[D29]	2700 SIL Validation Test Plan.doc, Ver 1, Sept 2008	2700 Coriolis Flowmeter Safety Validation Test Plan
[D30]	2700 SIL Validation Test Report, Ver 1.0, Nov 2008	2700 Coriolis Flowmeter Safety Validation Test Report
[D31]	DA03001R101.doc	Architecture Diagram for automated DVT Engine
[D32]	2400sManualDVT.xls	800 Manual DVT Tests
[D33]	DVT, 8/18/08	Design Validation Test Report Example
[D34]	LINT, 8/29/08	LINT Results
[D35]	BFSrc.UNIT_TEST_CodeS tats.xls	Code Module Unit Test Results summary spreadsheet
[D36]	Review 306, Rev 1.0, 11/15/04	Code review example – Coriolis Meter
[D37]	P/N 20001715, Rev B, 09/2006	Series 1000 and 2000 Transmitters - Configuration and Use Manual
[D38]	LWI 186, Rev H	Local Work Instruction 186 - Safety Manual Creation Guideline
[D39]	PN 20004482, Rev. BB	Model 1700 or Model 2700 Transmitter Safety Manual
[D40]	Tools Techniques and Measures per IEC 61508,	IEC 61508 Tables, document shows all tables from IEC 61508 Annex A and B from part 2 and part 3 along with details as to how Micro Motion meets each of the requirements.
[D41]	Training record.jpg, 10/08	Sample of a training record for a SIL team member
[D42]	Control Procedure Index, 10/01/08	Index of Micro Motion Control Procedures
[D43]	Rev_Updates_GWI_LWI_Curr ent 2023-03-16.xlsx	Local Work Instructions Index for Micro Motion, Boulder
[D44]	product-data-sheet-micro- motion-1000-2000- transmitters-mvd-technology- en-62188.pdf, Rev AA	Product Data Sheet Series 1000 and 2000 transmitters
[D45]	product-data-sheet-micro- motion-technical-overview- specification-summary-en- 7039478.pdf, April 02	Product Data Sheet Micro Motion Flowmeters
[D46]	MM 2700 Fault Injection Summary rev. 2.xls	Fault Injection Test Plan
[D47]	701-081/2004T, Rev 1.0, 2005-Nov-10	TUV Nord Certification Report of the 1700/2700 Coriolis Flowmeter
[D48]	Sales	Shipments spreadsheet for 1700/2700
-	•	



[D49]	Warranty returns	Warranty Failure data spreadsheet for 1700/2700
[D50]	MVD SOFTWARE REVISION OVERVIEW.pdf, Rev. BZ	MVD SOFTWARE REVISION OVERVIEW
[D51]	IEC Tables, 0.2; 1/7/2008	IEC 61508 Tables, document shows all tables from IEC 61508 Annex A and B from part 2 and part 3 along with details as to how Micro Motion meets each of the requirements.
[D52]	manual-micro-motion-1700- 2700-transmitters-en- 62378.pdf; Rev CH	1700 and 2700 Transmitters Installation Manual
[D53]	manual-micro-motion- model-1700-transmitters- analog-outputs-en- 62454.pdf, Rev AC	1700 Transmitters with Analog Outputs - Configuration and Use Manual
[D54]	manual-configuration-use- manual-micro-motion- 1700-transmitters- intrinsically-safe-outputs- en-62464.pdf, Rev AC	1700 Transmitters with Intrinsically Safe Outputs - Configuration and Use Manual
[D55]	manual-micro-motion- 2700-transmitters-analog- outputs-en-62678.pdf, Rev AC	2700 Transmitters with Analog Outputs - Configuration and Use Manual
[D56]	manual-micro-motion- 2700-transmitters- intrinsically-safe-outputs- en-62742.pdf, Rev AC	2700 Transmitters with Intrinsically Safe Outputs - Configuration and Use Manual
[D57]	manual-micro-motion- 2700-transmitters- configurable-input-outputs- en-62722.pdf, Rev AC	2700 Transmitters with Configurable Input/Outputs - Configuration and Use Manual

2.4.2 Documentation generated by exida

[R1]	MiMo 08/04-67r1 R001 V2R2, 10/21/2008	FMEDA report, Coriolis Flowmeter 1700 / 2700 Transmitter, with 700 CP
[R2]	MiMo 08/04-67r1 R001 V2R2, 10/21/2008	FMEDA report, Coriolis Flowmeter 1700 / 2700 Transmitter, with 800 ECP
[R3]	MiMO 04-06-22 R001, V2 R2, 4/1/2005	1700/2700 Proven In Use Assessment
[R4]	Field_Failure_Analysis_Mic romotion 800 ECP.xls	exida field failure analysis summary spreadsheet to calculate failure rates based on field experience
[R5]	MM 08-09-19 R001, V1 R1, 9/30/2008	800 Enhanced Core Processor Proven In Use Assessment
[R6]	MM 08/04-67 R001, V1 R1	Software Criticality Analysis / HAZOP Report



[R7]	MM 2700 Fault Injection Results-GPS.xls, 10/7/2008	Fault Injection Tests and Results
[R8]	MM 08-04-67 R004 V1R1 IEC 61508 Assessment.doc, 12/9/08	IEC 61508 Functional Safety Assessment for Micro Motion Series 1700/2700 Flowmeters with 700 CP
[R9]	MM 08-04-67 R005 V1R1 IEC 61508 Assessment.doc, 12/9/08	IEC 61508 Functional Safety Assessment for Micro Motion 1700/2700 Coriolis Flowmeter with 800 ECP



3 Product Description

This assessment is for the Micro Motion 1700/2700 Coriolis Flowmeter which consist of a series CMF (Elite), T, F, H, R, DT (700 CP only) or HPC010 (800 ECP only) sensor with a Standard 700 CP or 800 ECP and a 1700 / 2700 transmitter.

The Micro Motion 1700/2700 Coriolis Flowmeter is a smart device used in many different industries for both control and safety applications. The Model 1700 / 2700 features MVD™ technology and diagnostics. It allows for multivariable measurement of mass flow, volume flow, density, and temperature. Output options include frequency, milliamp, discrete in, discrete out, HART, Modbus, Foundation Fieldbus H1, or Profibus-PA; intrinsically safe outputs with one frequency and two milliamp outputs are also available.

The analog milliamp output is used for the safety critical variable (mass flow, volume flow or density); all other outputs are considered outside the scope of Safety Instrumented Systems (SIS) usage.

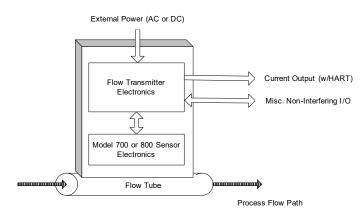


Figure 1 Micro Motion 1700/2700 Coriolis Flowmeter, Parts included in the Assessment

Note: See 2023 IEC 61508 Functional Safety Surveillance Audit section for the current assessed versions information.

In all applications considered, the normal operating condition is when the output mA signal represents the input Flow (or Density) within the Safety Accuracy of 2%. The fail-safe state for when the diagnostics determines there is a fault is configurable and may be either high or low.

The Micro Motion 1700/2700 Coriolis Flowmeter are classified as a Type B¹ element according to IEC 61508, having a hardware fault tolerance of 0.

-

¹ Type B element: "Complex" element (using complex components such as micro controllers or programmable logic); for details see 7.4.4.1.3 of IEC 61508-2, ed 2. 2010.



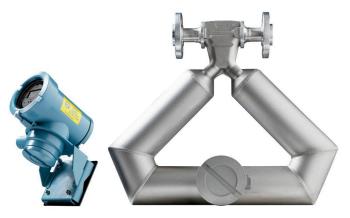


Figure 2 Micro Motion 2700 and an Elite Sensor (CMF100) with 700 CP in a SS housing



Figure 3 Micro Motion Elite Sensor (CMF100) with 800 ECP and a 2700



3.1 Hardware and Software Version Numbers

Note: see section 6 for updates.

This assessment is applicable to the following hardware and software versions of Micro Motion 1700/2700 Coriolis Flowmeter:

1700 Series	Micro Motion Coriolis Flowmeter with 1700 transmitter with 700 CP or 800 ECP and Analog Output or Intrinsically Safe Output (output codes A or D)
2700 Series	Micro Motion Coriolis Flowmeter with 2700 transmitter with 700 CP or 800 ECP and output codes A, B, C or D
Sensors	Elite, T, F, H, R, DT (700 CP only) or HPC010 (800 ECP only)
Hardware	Based on rev AG BOM (or later)
Software/Firmware (listed versions or later)	1700/2700: v6.6 700 Core: v3.40 or 800 Core: v4.02



4 IEC 61508 Functional Safety Assessment Scheme

exida assessed the development process used by Emerson for this development project against the objectives of the exida certification scheme which includes subsets of IEC 61508-1 to -3.

4.1 Methodology

The full functional safety assessment includes an assessment of all fault avoidance and fault control measures during hardware and software development and demonstrates full compliance with IEC 61508 to the end-user. The assessment considers all requirements of IEC 61508. Any requirements that have been deemed not applicable have been marked as such in the full Safety Case report, e.g. software development requirements for a product with no software.

As part of the IEC 61508 functional safety assessment the following aspects have been reviewed:

- Development process, including:
 - Functional Safety Management, including training and competence recording, FSM planning, and configuration management
 - Specification process, techniques and documentation
 - o Design process, techniques and documentation, including tools used
 - Validation activities, including development test procedures, test plans and reports, production test procedures and documentation
 - Verification activities and documentation
 - Modification process and documentation
 - Installation, operation, and maintenance requirements, including user documentation
 - Manufacturing Quality System
- Product design
 - Hardware architecture and failure behavior, documented in a FMEDA
 - Software architecture and failure behavior, documented in a Software Criticality and Software HAZOP report
- Product Field History
 - Hours of field operation
 - Field failure history
- Product Certifications
 - TUV IEC 61508 Certification Report for 1700/2700 Coriolis Flowmeter

The review of the development procedures is described in section 5.1. The review of the product design is described in section 5.3. The review of the product field history is described in section 5.2.



4.2 Assessment level

The Micro Motion 1700/2700 Coriolis Flowmeter with either the 700 or 800 Core have been assessed per IEC 61508 to the following levels:

- SIL 2 capability, single use (Hardware Fault Tolerance = 0)
- SIL 3 capability, redundant use (Hardware Fault Tolerance = 1)

The development procedures were assessed as suitable for use in applications with a maximum Safety Integrity Level of 3 (SIL 3) according to IEC 61508.



5 Results of the IEC 61508 Functional Safety Assessment

exida Certification assessed the development process used by Emerson during the product development against the objectives of the exida certification scheme which includes IEC 61508 parts 1, 2, and 3 [N1]. Some of the development of the Micro Motion 1700/2700 Coriolis Flowmeter was done prior to Micro Motion establishing their fully compliant development process. Consequently, for the evaluation of some of the systematic fault avoidance measures, some weight was given to proven in use considerations to offset the absence of some avoidance items. The most recent and all future modifications to the Micro Motion 1700/2700 Coriolis Flowmeter must be made per the IEC 61508 SIL 3 compliant change/development process.

5.1 Lifecycle Activities and Fault Avoidance Measures

Emerson has an IEC 61508 compliant development process as assessed during the IEC 61508 certification. This compliant development process is documented in the SafetyCaseDB [D1].

This functional safety assessment investigated the compliance with IEC 61508 of the processes, procedures and techniques as implemented for the 1700/2700 Coriolis Flowmeter development. The investigation was executed using the exida certification scheme which includes subsets of the IEC 61508 requirements tailored to the SIL 3 work scope of the development team. The result of the assessment can be summarized by the following observations:

The audited Emerson development process complies with the relevant managerial requirements of IEC 61508 SIL 3.

5.1.1 Functional Safety Management

FSM Planning

The functional safety management of any Emerson Safety Instrumented Systems Product development is governed by Control Procedure (CP) 18 [D2]. Micro Motion utilizes a Stage-Gate model for their product development projects. This Stage-Gate process governs all product development activity from the project kick-off through release to production and eventual discontinuance of the product. The Micro Motion Stage-Gate process is derived from the Emerson Stage-Gate process and is divided into 9 phases. For each development Micro Motion creates a Development Management Plan [D3] which defines all of the tasks that must be done to ensure functional safety as well as the person(s) responsible for each task. These processes and the procedures referenced herein fulfill the requirements of IEC 61508 with respect to functional safety management.

Version Control

All documents are under version control as documented in [D1]. Emerson uses PVCS for its revision control of all documents and specifications related to the project. Product documentation is controlled by CP 36 and is managed using Product Data Management (PDM).

Training, Competency recording

Selection of the team members is handled by management in accordance with CP 18. Personnel training records are kept in accordance with IEC 61508 requirements as documented in [D1] and demonstrated in [D41]. Emerson hired exida Certification to be the independent assessor per IEC 61508.



5.1.2 Safety Requirements Specification and Architecture Design

As defined in the Development Management Plan [D3], a System Architecture and Safety Requirements Specification (SASRD) [D5] is done for all products that must meet IEC 61508 requirements. The requirements specification contains the product safety constraints, safety integrity requirements, product architecture, and the hardware and software architecture requirements. This document includes block diagrams of the overall architecture, dataflow for both hardware and software as well as identifiers for tracking of the requirements. The SASRS has been reviewed by *exida*. During the assessment, *exida* Certification reviewed the content of the specification for completeness per the requirements of IEC 61508.

Requirements for the project were traced using Requisite Pro. Each requirement identified in the Customer Requirements Document can be traced to a system-level requirement. Each system-level requirement can then be traced to a requirement(s) in the software requirements specification(s) and/or hardware requirements specification(s). These in turn are traceable down to either a test case in the Design Verification Test plan for the software or the Test Spec for the transmitter.

Requirements from **IEC 61508-2, Table B.1** that have been met by Emerson include project management, documentation, separation of safety requirements from non-safety requirements, structured specification, inspection of the specification, semi-formal methods and checklists. [D40] & [D51] documents more details on how each of these requirements have been met. This meets the requirements of SIL 3.

5.1.3 Hardware Design

Hardware design, including both electrical and mechanical design, is done according to [D3] and [D2]. The hardware design process includes component selection, detailed drawings and schematics, a failure modes, effects and diagnostic analysis (FMEDA), design reviews, the creating of prototypes, and hardware verification tests.

Requirements from **IEC 61508-2**, **Table B.2** that have been met by Emerson include observance of guidelines and standards, project management, documentation, structured design, modularization, use of well-tried components, checklists, semi-formal methods, computer aided design tools, simulation, and inspection of the specification. This meets the requirements of SIL 3.

5.1.4 Software Design

During the prior certification process of the similar 1700/2700 Flowmeters with standard 700 core, some additional changes and enhancements to the software process were incorporated by Micro Motion. A Proven in Use analysis was performed on 1700/2700 Flowmeters with the 800 Core (section 5.2). This analysis was supplemented with a Software Criticality Analysis / HAZOP Report [R6] which further details the extra testing and analysis that was used in evaluating the software and its design process. The latest software version for the 800 core also had each of its complex modules fully module tested. Coding standards, code reviews, module testing, LINT testing, fault injection tests boundary value tests, and Design Validation Testing are all techniques now used for changes to the software. This meets the requirements of SIL 3.



5.1.5 Validation

All safety requirements documented in the SASRD [D5] are validated by test or inspection. A validation test specification and plan [D29] was created for the Micro Motion 1700/2700 Coriolis Flowmeter and reviewed as part of the assessment. Each validation test includes an explicit test to the requirement being validated. As part of the assessment, it was verified that all safety requirements were covered by one or more validation tests. Procedures are in place for corrective actions to be taken when tests fail as documented in [D1] and [D17].

Requirements from IEC **61508-2, Table B.3** that have been met by Emerson including functional testing, project management, documentation, and black-box testing. [D40] & [D51] documents more details on how each of these requirements are met. This meets the requirements of SIL 3.

Requirements from IEC **61508-2, Table B.5** that have been met by Emerson include functional testing and functional testing under environmental conditions, Interference surge immunity testing, fault insertion testing, project management, documentation, static analysis, dynamic analysis, and failure analysis, expanded functional testing and black-box testing. [D40] & [D51] documents more details on how each of these requirements has been met. This meets SIL 3.

5.1.6 Verification

The development and verification activities are defined in [D2] and [D3]. Verification activities include the following: Design Review Meetings, Hardware Verification Testing, FMEDA, Module Testing, Module Integration Test, and Software Inspection.

5.1.7 Modifications

Modifications are done per Micro Motion's IEC 61508 SIL 3 compliant ECR/ECO procedure CP 36 [D17]. A large change project would be treated as a new development and is required to go through the full new development process CP 18. Additional automatic measures have been put into place to ensure that a SIL impact analysis is performed when any part or assembly that is a component on a SIL approved device is part of an ECR. This meets the requirements of IEC 61508 SIL 3.

5.1.8 User documentation

Emerson created a Safety Manual for the Micro Motion 1700/2700 Coriolis Flowmeter, [D39]. This safety manual was assessed by *exida*. The final version is compliant with the requirements of IEC 61508. The document includes all required reliability data and operations, maintenance, (or references to) and proof test procedures.

Requirements from IEC 61508-2, Table B.4 that have been met by Emerson include operation and maintenance instructions, user friendliness, maintenance friendliness, project management, documentation, limited operation possibilities, protection against operator mistakes, and operation only by skilled operators. [D40] & [D51] documents more details on how each of these requirements has been met. This meets the requirements for SIL 3.

5.2 Proven in Use

In 2005 the Micro Motion 1700/2700 Coriolis Flowmeter with the 700 Core were evaluated and determined to meet the proven in use requirements of IEC 61508 (See document [R3]). This transmitter has been in the field since 2001. Back in 2005 over 50,000 units had over 300 million



hours of documented run time in the field. Based on field return data, the estimated field failure rate of the device is 6.73E-07 failures per hour. The documented operating hours and field failure rate are sufficient to meet the proven in use requirements for SIL 3.

A second proven in use assessment was done for transmitters with the 800 ECP [R5]. This report showed that although the failure rates were sufficient for proven in use of the hardware, there were not enough field hours of run time of the latest software version to accept this alone as sufficient proof for a SIL 3 device. Thus the 800 ECP assessment is not wholly based on Proven in Use. This along with the other design measures used in the development of the 800 ECP meets the requirements for systematic capability of IEC 61508.

5.3 Hardware Assessment

To evaluate the hardware design of the Micro Motion 1700/2700 Coriolis Flowmeter, a Failure Modes, Effects, and Diagnostic Analysis was performed by exida for each component in the system. This is documented in [R1] and [R2]. The FMEDAs were verified using Fault Injection Testing as part of the IEC 61508 assessment [R7].

A Failure Modes and Effects Analysis (FMEA) is a systematic way to identify and evaluate the effects of different component failure modes, to determine what could eliminate or reduce the chance of failure, and to document the system in consideration. An FMEDA (Failure Mode Effect and Diagnostic Analysis) is an FMEA extension. It combines standard FMEA techniques with extension to identify online diagnostics techniques and the failure modes relevant to safety instrumented system design.

From the FMEDA failure rates are derived for each important failure category. The failure rates are valid for the useful life of the devices.

These results must be considered in combination with PFD_{AVG} of other devices of a Safety Instrumented Function (SIF) to determine suitability for a specific Safety Integrity Level (SIL).

The analysis shows that the design of the Micro Motion 1700/2700 Coriolis Flowmeter meets the hardware requirements of IEC 61508, SIL 2 @ HFT=0 and SIL 3 @ HFT=1.



6 2023 IEC 61508 Functional Safety Surveillance Audit

6.1 Roles of the parties involved

Manufacturer of the Micro Motion 1700/2700 Coriolis Flowmeter **Emerson**

exida Performed the hardware assessment review

exida Performed the IEC 61508 Functional Safety Surveillance Audit per

the accredited *exida* scheme.

Emerson contracted exida in January 2023 to perform the surveillance audit for the above Micro Motion 1700/2700 Coriolis Flowmeter with either the 700 or 800 Core. The surveillance audit was conducted remotely with Micro Motion's facility in Boulder, CO - USA during April/May 2023.

6.2 Surveillance Methodology

As part of the IEC 61508 functional safety surveillance audit the following aspects have been reviewed:

- Procedure Changes Changes to relevant procedures since the last audit are reviewed to determine that the modified procedures meet the requirements of the exida certification scheme.
- Engineering Changes The engineering change list is reviewed to determine if any of the changes could affect the safety function of the Micro Motion 1700/2700 Coriolis Flowmeter with either the 700 or 800 Core.
- Impact Analysis If changes were made to the product design, the impact analysis associated with the change will be reviewed to see that the functional safety requirements for an impact analysis have been met.
- Field History Shipping and field returns during the certification period will be reviewed to determine if any systematic failures have occurred. If systematic failures have occurred during the certification period, the corrective action that was taken to eliminate the systematic failure(s) will be reviewed to determine that said action followed the approved processes and was effective.
- Safety Manual The latest version of the safety manual will be reviewed to determine that it meets the IEC 61508 requirements for a safety manual.
- FMEDA Update If required or requested the FMEDA will be updated. This is typically done if there are changes to the IEC 61508 standard and/or changes to the exida failure rate database.
- Evaluate use of the certificate and/or certification mark Conduct a search of the applicant's web site and document any misuse of the certificate and/or certification mark. Report any misuse of the certificate and/or certification mark to the exida Managing Director.
- Recommendations from Previous Audits If there are recommendations from the previous audit, these are reviewed to see if the recommendations have been implemented properly.



6.2.1 Documentation provided by Emerson

[D58]	Flow Measurement Quality Manual.pdf, , Rev AH 3/9/2020	Quality Manual
[D59]	2021x_SOP_25_AA_SIL Process.docx, Rev AA, 24 Nov 2021	Standard Operating Procedure (SOP), Enovia, SIL Process
[D60]	GWI 03 Technical Bulletins, Service Bulletins and Knowledge Based Articles.docx, Rev H, 10 Sept 2020	Flow Measurement Global Work Instruction – GWI 03 Technical Bulletins, Service Bulletins and Knowledge Based Articles
[D61]	GWI 32 Mean Time Between Failure Calculation Procedure.docx, Rev F, 2 Feb 2023	Flow Measurement Global Work Instruction – GWI 32 Mean Time Between Failure Calculation Procedure
[D62]	GWI 33 Sustaining Engineering Stage Gate Process.docx, Rev J, 21 Nov 2022	Flow Measurement Global Work Instruction – GWI 33 Sustaining Engineering Stage Gate Process
[D63]	GWI 47 Non-conforming Material, Process and System Identification and Data Collection.docx, Rev AI, 28 Sept 2022	Flow Measurement Global Work Instruction – GWI 47 Non-conforming Material, Process and System Identification and Data Collection
[D64]	GWI 89 Four Corners Test Procedure.docx, Rev F, 1 Feb 2023	Flow Measurement Global Work Instruction – GWI 89 Four Corners Test Procedure
[D65]	GWI 90 Product Safety Messages.docx, Rev K, 1 Feb 2023	Flow Measurement Global Work Instruction – GWI 90 Product Safety Messages
[D66]	GWI 92 Checklist for Safety.docx, Rev L, 4/28/2022	Global Work Instruction – GWI 92 Checklist for Safety
[D67]	GWI 140 New Product Development Process.docx, Rev C 12/8/22	Flow Measurement Global Work Instruction – GWI 140 New Product Development Process
[D68]	GWI 146 Vibration Procedure.docx, Rev C, 12 Jan 2023	Flow Measurement Global Work Instruction – GWI 146 Vibration Procedure
[D69]	GWI 235 RMA Evaluation Writing Standard.docx, Rev G, 31 Jan 2023	Flow Measurement Global Work Instruction – GWI 235 RMA Evaluation Writing Standard
[D70]	GWI 305 Product Safety.docx, Rev M, 4/5/2021	Flow Measurement Global Work Instruction – GWI 305 Product Safety
[D71]	GWI 320 Global Deviation System.docx, Rev X, 1 Feb 2022	Flow Measurement Global Work Instruction – GWI 320 Global Deviation System



[D72]	GWI 321 Document Control.docx, Rev T, 1 May 2022	Flow Measurement Global Work Instruction – GWI 321 Document Control
[D73]	GWI 336 Design Change Process.docx, Rev Q, 4/16/2021	Flow Measurement Global Work Instruction – GWI 336 Design Change Process
[D74]	GWI 336-A5 SIL Impact Analysis Worksheet.docx, Rev A, 8/5/2020	Flow Measurement Global Work Instruction – GWI 336 SIL Impact Analysis Worksheet
[D75]	GWI 355 Internal Audits.docx, Rev AC, 12 Dec 2022	Flow Measurement Global Work Instruction – GWI 355 Internal Audits
[D76]	GWI 358 Stop Ship Procedure .docx, Rev M, 8/31/2022	Flow Measurement Global Work Instruction – GWI 358 Stop Ship Procedure
[D77]	GWI 371 Product Notification.docx, Rev H, 26 Jan 2023	Flow Measurement Global Work Instruction – GWI 371 Product Notification
[D78]	GWI 380 Supplier Quality Manual.docx, Rev Q, 9 Sept 2022	Flow Measurement Global Work Instruction – GWI 380 Supplier Quality Manual
[D79]	LWI 15 Return Material Authorization.docx, Rev AH, 9 April 2021	Flow Measurement Local Work Instruction – LWI 15 Return Material Authorization
[D80]	LWI 23 Software Development Process.docx, Rev AJ, 3/3/2022	Flow Measurement Local Work Instruction – LWI 23 Software Development Process
[D81]	LWI 31 Inspection, Measuring and Test Equipment Calibration.docx, Rev P, 5/21/2021	Flow Measurement Local Work Instruction – LWI 31 Inspections, Measuring and Test Equipment Calibration
[D82]	LWI 133 Systems Architecture and Safety Requirements Guidelines.docx, Rev M, 4/20/2021	Flow Measurement Local Work Instruction – LWI 133 Systems Architecture and Safety Requirements Guidelines
[D83]	LWI 186 Safety Manual Creation Guideline.docx, Rev H, 2/14/2022	Local Work Instruction – LWI 186 Safety Manual Creation Guideline
[D84]	MVD SOFTWARE REVISION OVERVIEW.pdf, Rev BZ, 12/21/2022	MVD Electronics Firmware Release Overview
[D85]	Flow ISO 9001 cert to 2025.pdf, Expires 28 December 2025	ISO 9001:2015 Quality Management Standard Certificate
[D86]	Rev_Updates_GWI_LWI_Current 2023-03-16.xlsx, 2023-03-16	Revision Updates to GWI and LWI documents
[D87]	Electronics Data Export eStatit V1.xlsx, 1 Oct 2019 – 3 Feb 2023	Electronics Return Data 700 / 800 / 1700 / 2700 / 4200 / 5700
[D88]	Sensors Data Export eStatit V1.xlsx, 1 Oct 2019 – 3 Feb 2023	Sensor Return Data K / LF / T / F-H-R / D / Elite
[D89]	HPC and D Sensors Data V2.xlsx, May 2023	HPC and D Sensor Sales Data
[D90]	WF-18 Comparisons 2018- 2023.pptx, May 2023	Sales Data for Elite Sensors, T Sensors, F Sensors, 700 Core, 800 Core, 1700/2700, 4200, 5700



[D91]	Copy of Sensor Shipments FY20 to FY23.xlsx	Sensor Shipment Data, Provided by Emerson MicroMotion, but [D87], [D88], [D89], [D90] primarily used for FFA
[D92]	Copy of Sensor Returns FY20 to FY23.xlsx	Sensor Return Data, Provided by Emerson MicroMotion, but [D87], [D88], [D89], [D90] primarily used for FFA
[D93]	PQR 2022-12-21 Charts.pptx	Sales Charts, Provided by Emerson MicroMotion, but [D87], [D88], [D89], [D90] primarily used for FFA
[D94]	Sales and returns.xlsx	Sales and return data, Provided by Emerson MicroMotion, but [D87], [D88], [D89], [D90] primarily used for FFA
[D95]	SIL Impact Changes List (New Version).xlsx	Change Numbers and Descriptions for 5700 / 4200 / 1700-2700 / 800 / 700
[D96]	MMI SIL 2700 SASRD.doc, Rev 0.5, January 2017	1700 / 2700 Coriolis Flowmeter System, Architecture and Safety Requirements Specification
[D97]	800SRS.DOC, Rev A.14, 7/23/2019	Software Requirements Specification, 800 Series SRS
[D98]	801CRD.DOC, Rev 1.1, 7/28/2004	Model 801 Transmitter Customer Requirements Document
[D99]	Code review.doc, 9/28/2022	Review Meeting Minutes Form, 800v5.4
[D100]	RE_ Tired yet_c.msg, 9/29/2022	800v5.4 Code Review Approval
[D101]	RE_ Tired yet_x.msg, 9/29/2022	800v5.4 Code Review Approval
[D102]	800 v5_40 SCRs.xlsx, 9/27/2022	SCRs in Review – Report for 800v5.4
[D103]	GWI 336-A9 SIL IAWrB 800v5.40.docx, 10/4/2022	SIL Impact Analysis Worksheet
[D104]	dsp_getdrivesignal.docx, 9/28/2022	800v5.4 - Unit Testing Results, Get Drive Signal
[D105]	dspchain_stage2filter_init.docx, 9/28/2022	800v5.4 - Unit Testing Results, DSP Chain Stage 2 Filter
[D106]	dspchain_update.docx, 9/28/2022	800v5.4 - Unit Testing Results, DSP Chain Update
[D107]	sensor_findSlot.docx, 9/28/2022	800v5.4 - Unit Testing Results, Sensor ID Find Slot
[D108]	sensor_setattributes.docx, 9/28/2022	800v5.4 - Unit Testing Results, Sensor ID Set Attributes
[D109]	manual-micro-motion-1700-2700- transmitters-en-62378.pdf, Rev CH, October 2022	Micro Motion 1700 and 2700 Transmitters, Installation Manual
[D110]	manual-micro-motion-model-1700- transmitters-analog-outputs-en- 62454.pdf, Rev AC, July 2022	Micro Motion Model 1700 Transmitters with Analog Outputs, Configuration and Use Manual



[D111]	manual-configuration-use-manual- micro-motion-1700-transmitters- intrinsically-safe-outputs-en- 62464.pdf, Rev AC, March 2022	Micro Motion 1700 Transmitters with Intrinsically Safe Outputs, Configuration and Use Manual
[D112]	manual-micro-motion-2700- transmitters-analog-outputs-en- 62678.pdf, Rev AC, February 2022	Micro Motion 2700 Transmitters with Analog Outputs, Configuration and Use Manual
[D113]	manual-micro-motion-2700- transmitters-intrinsically-safe- outputs-en-62742.pdf, Rev AC, May 2022	Micro Motion 2700 Transmitters with Intrinsically Safe Outputs, Configuration and Use Manual
[D114]	manual-micro-motion-2700- transmitters-configurable-input- outputs-en-62722.pdf, Rev AC, October 2022	Micro Motion 2700 Transmitters with Configurable Input/Outputs
[D115]	product-data-sheet-micro-motion- 1000-2000-transmitters-mvd- technology-en-62188.pdf, Rev AA, July 2022	Micro Motion 1000 and 2000 Transmitters with MVD Technology

6.2.2 Surveillance Documentation generated by exida

[R10]	EMM 04-06-22 R004 V5R1 FMEDA 1700-2700 700CP	FMEDA report, 1700 / 2700 Coriolis Flowmeter Series with Standard 700 Core
[R11]	EMM 08-04-67 R001 V5R1 FMEDA 1700-2700 800ECP	FMEDA report, 1700 / 2700 Coriolis Flowmeter Series with Enhanced 800 Core
[R12]	EMM 20-01-176 FFA1 V2R0	Field Failure Analysis - Transmitter 1700_2700, Cores and Sensors
[R13]	Prodfails - Further Beak out of numbers 2023_VAM.xlsx, May 2023	Compilation of data from [D87], [D88], [D89], [D90]
[R14]	EMM_B V2R0 61508 Safety Case WB - Baseline.xlsm, 22 May 2023	Baseline Safety Case for SC Boulder Process
[R15]	EMM 23-01-183 IEC 61508 Surveillance Audit Checklist	Surveillance Audit Checklist

6.3 Surveillance Results

6.3.1 Procedure Changes

Only minor changes have been made to procedures since the 2020 Surveillance Audit. Changes were reviewed and found to be consistent with the requirements of IEC 61508.



6.3.2 Engineering Changes

Lists of Hardware and Software changes since the last audit were reviewed. Each of the changes were judged to be sufficiently evaluated by Micro Motion for functional safety and documented in accordance with Micro Motion's procedures.

6.3.3 Impact Analysis

The SIL Impact Analysis Worksheets for the hardware and software changes were reviewed and found to be adequately documented given the scope of the simple changes made to this mature product.

6.3.4 Field History

Worldwide Shipment and Return information were reviewed for each of the 4 main components of the 1700 / 2700 flowmeter (the 1700/2700 transmitter, the sensors, and the 700 or 800 core). For the returns, the WF-18 information was used. The data used was for the 3-year period between October 2019 to January 2023. The calculated actual field failure rate is below the predicted failure rate of the FMEDA.

Management holds regular quality meetings to monitor this as well.

6.3.5 Safety Manual

The safety manual has not changed since the 2020 Surveillance Audit of the Micro Motion 1700/2700 Coriolis Flowmeter. Rev BB is the current version of the safety manual and was found to be publicly available on Micro Motion's website. The contents of the manual were found to be acceptable.

6.3.6 FMEDA Update

The content of the FMEDA analyses were not affected (failure rates, assumptions, etc.), but the reports were updated for formatting and some minor changes to boilerplate text.

6.3.7 Evaluate use of certificate and/or certification mark

The Micro Motion website was searched and no misleading or misuse of the certification or certification marks was found.

6.3.8 Previous Recommendations

No previous recommendations needed to be implemented.

6.3.9 Additional Manufacturing locations

In addition to the main design and manufacturing location in Boulder CO, Micro Motion has 4 other sites that are approved to produce Sensors and finished Transmitter assemblies. These are in Chihuahua, Mexico; Nanjing, China; Ede, Netherlands; and Cluj, Romania.



6.3.10 Assessed Configurations / Versions

Some sensor models have been added and others removed in the years since the initial audit. The following table lists the current assessed configurations and Hardware/Software versions:

Table 1 Assessed Configurations / Versions

1700 Series	Micro Motion Coriolis Flowmeter with 1700 transmitter with 700 CP or 800 ECP and Analog Output or Intrinsically Safe Output (output codes A or D)	
2700 Series	Micro Motion Coriolis Flowmeter with 2700 transmitter with 700 CP or 800 ECP and output codes A, B, C or D	
Sensors	Elite, T, F, H, R, DT (700 CP only) or HPC, TA (800 ECP only)	
Hardware	Based on rev AG BOM (or later)	
Software/Firmware (listed versions or later)	1700/2700: v6.6 700 Core: v3.40 or 800 Core: v5.33	

6.4 Surveillance Audit Conclusion

The result of the Surveillance Audit Assessment can be summarized by the following observations:

The Emerson Micro Motion 1700/2700 Coriolis Flowmeter continues to meet the relevant requirements of IEC 61508:2010 for SIL 3 in low or high demand safety applications based on the initial assessment and considering:

- field failure history
- permitted modifications completed on the product
- FMEDA report updates

This conclusion is supported by the updated SafetyCase and certification documents.



7 Terms and Definitions

Architectural Constraint The SIL limit imposed by the combination of SFF and HFT for Route 1_H

or by the HFT and Diagnostic Coverage (DC applies to Type B only) for

Route 2_H

exida criteria A conservative approach to arriving at failure rates suitable for use in

hardware evaluations utilizing the 2_H Route in IEC 61508-2.

Fault tolerance Ability of a functional unit to continue to perform a required function in the

presence of faults or errors (IEC 61508-4, 3.6.3)

FIT Failure In Time (1x10⁻⁹ failures per hour)

Failure Mode Effect and Diagnostic Analysis **FMEDA**

HART Highway Addressable Remote Transducer

HFT Hardware Fault Tolerance

Low demand mode Mode where the demand interval for operation made on a safety-related

system is greater than twice the proof test interval.

High demand mode Mode where the demand interval for operation made on a safety-related

system is less than 100x the diagnostic detection/reaction interval, or

where the safe state is part of normal operation.

PFD_{avq} Average Probability of Failure on Demand

SFF Safe Failure Fraction summarizes the fraction of failures, which lead to a

safe state and the fraction of failures which will be detected by diagnostic

measures and lead to a defined safety action.

SIF Safety Instrumented Function

SIL Safety Integrity Level

SIS Safety Instrumented System – Implementation of one or more Safety

Instrumented Functions. A SIS is composed of any combination of

sensor(s), logic solver(s), and final element(s).

Systematic Capability The SIL limit imposed by the capability of the products manufacturer.

Type A element "Non-Complex" element (using discrete components); for details see

7.4.4.1.2 of IEC 61508-2

Type B element element (using complex components such as micro

controllers or programmable logic); for details see 7.4.4.1.3 of IEC

61508-2



8 Status of the document

8.1 Liability

exida prepares reports based on methods advocated in International standards. Failure rates are obtained from a collection of industrial databases. exida accepts no liability whatsoever for the use of these numbers or for the correctness of the standards on which the general calculation methods are based.

8.2 Version History

Contract Number	Report Number	Revision Notes
Q23/01-183	EMM 08-04-067 R005 V4R1	Updated sensor list to include TA (to match update made in FMEDA report during Surveillance Audit); VAM 6/2/2023
Q23/01-183	EMM 08-04-067 R005 V4R0	2023 Surveillance Audit; VAM 5/22/2023
Q20/01-176	EMM 08-04-067 R005 V3R0	2020 Renewal; Aligned expiration dates of 1700/2700, 5700 and 4200; DEB, 5/22/2020
Q17/02-079	EMM 08-04-067 R005 V2R1	Updated with 2017 Re-Cert audit, combined 700 and 800 Core reports, and added H & HPC Sensors, G Sauk, 1-May-2017
Q16/01-126	EMM 08-04-067 R005 V1R5	Updated FMEDA report reference, RPC, 2016-03-08
Q16/01-126	EMM 08-04-067 R005 V1R4	Updated for R sensors; updated FMEDA reference, RPC, 2016-01-29
Q14-02-049	EMM 08-04-067 R005 V1R3	Updated for renewal certification to IEC 61508:2010, 2nd ed., JCY, May 22, 2014
Q12-03-010	EMM 08-04-067 R005 V1R2	Updated for renewal certification, JCY, April 30, 2012
Q08/04-067	EMM 08-04-067 R005 V1R1	Revised some terminology, Released to Emerson; December 9, 2008
Q08/04-067	EMM 08-04-067 R005 V1R0	Initial version; November 2008

Review: Jonathan Moore, exida, 22 May 2023

Release status: Released, 22 May 2023

8.3 Future Enhancements

At request of client

8.4 Release Signatures

Walom Motto

Valerie Motto, CFSP, Safety Engineer

Jonathan Moore, CFSE, C. Eng – Director Advanced Systems